

CC1310 SimpleLink™ Wireless MCU Silicon Errata

This document describes known exceptions to the functional specifications for the CC1310 SimpleLink™ device.

1 Known Design Exceptions to Functional Specifications

Advisory List

Title	Page
Advisory — 32-kHz RC Oscillator Not Working	2
Advisory — Frequency Bands Not Yet Supported	2
Advisory — Data Rates Not Yet Supported	2
Advisory — Modulation Formats Not Yet Supported	2
Advisory — Synthesizer Calibration Might Fail on Rare Occasions.....	2
Advisory — Reading From Flash While Performing Clock Switching of the High Speed Oscillators (XOSC_HF and RCOSC_HF) Will Cause the System to Hang.....	3
Advisory — Slave Mode can Sample New TX Data From SYSBUS Clock Domain Using SSPCLK With no Synchronization	4
Advisory — Motorola®SPI Format Slave Mode Writes to Transmit FIFO can Lose Data	4

SimpleLink, Texas Instruments are trademarks of Texas Instruments.
 ARM, Cortex are registered trademarks of ARM Ltd.
 Motorola is a registered trademark of Motorola Trademark Holdings, LLC.
 All other trademarks are the property of their respective owners.

Advisory **32-kHz RC Oscillator Not Working**

Details RCOSC_LF (32.768 kHz) may occasionally produce glitches. The most common symptom when using RCOSC_LF as the low-frequency clock source is that the RTC is advanced or delayed by one SCLK_LF period. However, there may be other consequences such as system lock-up, potentially leading to an erroneous digital state and unpredicted behavior.

This item is fixed in CC1310 die revision B and later.

Suggested Workaround Use XOSC_LF as the low-frequency clock source (32.768-kHz crystal is required). Contact TI for more information through the *Proprietary Sub-1 GHz and SimpliciTI Forum* on [E2E](#).

Advisory **Frequency Bands Not Yet Supported**

Details The supported frequency bands at product release are 863 MHz to 876 MHz and 902 MHz to 928 MHz

CC1310 die rev B and later adds support for frequency bands in the 431-MHz to 527-MHz range.

Support for the 315- and 779-MHz frequency bands may be added to the CC1310 at a later time.

Suggested Workaround Functional testing at 315- and 779-MHz frequency bands has been performed, but full characterization is not yet completed. Support for the previously listed frequency bands will be added when they are complete. Contact TI for more information through the *Proprietary Sub-1 GHz and SimpliciTI Forum* on [E2E](#).

Advisory **Data Rates Not Yet Supported**

Details The supported data rate is up to 100 kbps. Support for higher data rates will be added to the CC1310 at a later time.

Suggested Workaround Functional testing at data rates over 100 kbps has been performed, but full characterization is not yet completed. Contact TI for more information through the *Proprietary Sub-1 GHz and SimpliciTI Forum* on [E2E](#).

Advisory **Modulation Formats Not Yet Supported**

Details 4-FSK is not yet supported.

Suggested Workaround Functional testing of 4-GFSK has been performed, but full characterization is not yet completed. Support for 4-FSK will be added through a firmware and software upgrade when ready. Contact TI for more information through the *Proprietary Sub-1 GHz and SimpliciTI Forum* on [E2E](#).

Advisory **Synthesizer Calibration Might Fail on Rare Occasions**

Description The synthesizer (synth) calibration has been observed to fail on rare occasions. This will cause any radio command that requires a calibrated synth to fail.

Suggested Workaround The workaround for a failed synth calibration is to calibrate again. For applications that use TI-RTOS or CC13xx Ware, but not the TI provided software stacks, it is recommended that proper run-time error handling is performed when executing a radio command. See the TI-RTOS documentation for error codes. For applications that use the software stacks delivered by Texas Instruments™ (BLE-Stack or TIMAC), no action is required because error handling is implemented by the stacks.

Advisory ***Reading From Flash While Performing Clock Switching of the High Speed Oscillators (XOSC_HF and RCOSC_HF) Will Cause the System to Hang***

Description

The CC1310 device contains five modules that can read from flash independently of each other. These five modules are:

- ARM® Cortex®-M3
- RF Core
- I2S
- DMA
- Crypto

Clock switching between XOSC_HF and RCOSC_HF can only be initiated by the Cortex-M3. While the Cortex-M3 performs clock switching, no other modules are allowed to read from the flash. The system will hang if any of the other four modules (RF core, I2S, DMA, Crypto) read from flash during this period.

Suggested Workaround

The user must make sure that the Cortex-M3 does not perform clock switching while any of the other four modules (RF core, I2S, DMA, Crypto) read from flash.

TI-RTOS

Clock switching from RCOSC_HF to XOSC_HF is done by calling `Power_setDependency (XOSC_HF)`. The user must register a notification to be notified when the clock switching is completed. When the notification function is called by the power driver, the clock switching is completed and it is safe for all modules to read from flash again.

Clock switching from XOSC_HF to RCOSC_HF is done by calling `Power_releaseDependency (XOSC_HF)`. When this function returns, the clock switching is completed and it is safe for all modules to read from flash again. The TI-RTOS radio driver never reads from flash, so it is safe to perform clock switching at all times when using this driver. However, it is up to the user to make sure that no clock switching is performed if the I2S, DMA, or Crypto modules read from flash.

Non-TI-RTOS

Clock switching is performed by calling the driverlib function `OSCHfSourceSwitch()`. When this function returns, it is safe for all modules to read from flash again. It is up to the user to make sure that no clock switching is performed if the RF core, I2S, DMA, or Crypto modules are read from flash.

Advisory — *Slave Mode can Sample New TX Data From SYSBUS Clock Domain Using SSPCLK With no Synchronization*
www.ti.com

Advisory *Slave Mode can Sample New TX Data From SYSBUS Clock Domain Using SSPCLK With no Synchronization*

Description When the SSI is programmed to operate in slave mode, the data written to the SSI data register in the SYSBUS clock domain can be sampled in the SSPCLK domain or without any synchronization. This condition occurs when the SSI Transmit FIFO is empty and the SSI Data register [TOP:SSI0/SSI1:DR : 0x4000_0008] write access occurs as a new SPI master transfer starts and the SSI slave-state machine samples data to transmit. This issue causes written data to be lost.

Suggested Workaround There is no software workaround to fix this issue.

Advisory *Motorola® SPI Format Slave Mode Writes to Transmit FIFO can Lose Data*

Description If the SSI is configured to operate in Motorola® SPI slave mode, it is possible to lose write data because of the following two conditions:

- (i) A write to the SSI data register [TOP:SSI0/SSI1:DR: 0x4000_0008] occurs between a new SPI master transfer starting and the end of the first bit of incoming data
- (ii) A write to the SSI data register [TOP: SSI0/SSI1: DR: 0x4000_0008] occurs during the first bit of new incoming data in a back-to-back transfer sequence

Suggested Workaround There is no software workaround to fix this issue.

Revision History

NOTE: Page numbers for previous revisions may differ from page numbers in the current version.

Changes from October 27, 2016 to December 16, 2016 Page

- Deleted *Digital Features Not Yet Supported*..... 2
- Added *Synthesizer Calibration Might Fail on Rare Occasions*..... 2
- Added *Reading From Flash While Performing Clock Switching of the High Speed Oscillators (XOSC_HF and RCOSC_HF) Will Cause the System to Hang*..... 2
- Added *Slave Mode can Sample New TX Data From SYSBUS Clock Domain Using SSPCLK With no Synchronization* . 3
- Added *Motorola® SPI Format Slave Mode Writes to Transmit FIFO can Lose Data*..... 4

Changes from September 15, 2015 to October 27, 2016 Page

- Added fix revision for 32-kHz RC Oscillator 2
- Added support for 431-527 MHz frequency bands 2
- Deleted limitation of some modulation formats..... 2

IMPORTANT NOTICE

Texas Instruments Incorporated and its subsidiaries (TI) reserve the right to make corrections, enhancements, improvements and other changes to its semiconductor products and services per JESD46, latest issue, and to discontinue any product or service per JESD48, latest issue. Buyers should obtain the latest relevant information before placing orders and should verify that such information is current and complete. All semiconductor products (also referred to herein as "components") are sold subject to TI's terms and conditions of sale supplied at the time of order acknowledgment.

TI warrants performance of its components to the specifications applicable at the time of sale, in accordance with the warranty in TI's terms and conditions of sale of semiconductor products. Testing and other quality control techniques are used to the extent TI deems necessary to support this warranty. Except where mandated by applicable law, testing of all parameters of each component is not necessarily performed.

TI assumes no liability for applications assistance or the design of Buyers' products. Buyers are responsible for their products and applications using TI components. To minimize the risks associated with Buyers' products and applications, Buyers should provide adequate design and operating safeguards.

TI does not warrant or represent that any license, either express or implied, is granted under any patent right, copyright, mask work right, or other intellectual property right relating to any combination, machine, or process in which TI components or services are used. Information published by TI regarding third-party products or services does not constitute a license to use such products or services or a warranty or endorsement thereof. Use of such information may require a license from a third party under the patents or other intellectual property of the third party, or a license from TI under the patents or other intellectual property of TI.

Reproduction of significant portions of TI information in TI data books or data sheets is permissible only if reproduction is without alteration and is accompanied by all associated warranties, conditions, limitations, and notices. TI is not responsible or liable for such altered documentation. Information of third parties may be subject to additional restrictions.

Resale of TI components or services with statements different from or beyond the parameters stated by TI for that component or service voids all express and any implied warranties for the associated TI component or service and is an unfair and deceptive business practice. TI is not responsible or liable for any such statements.

Buyer acknowledges and agrees that it is solely responsible for compliance with all legal, regulatory and safety-related requirements concerning its products, and any use of TI components in its applications, notwithstanding any applications-related information or support that may be provided by TI. Buyer represents and agrees that it has all the necessary expertise to create and implement safeguards which anticipate dangerous consequences of failures, monitor failures and their consequences, lessen the likelihood of failures that might cause harm and take appropriate remedial actions. Buyer will fully indemnify TI and its representatives against any damages arising out of the use of any TI components in safety-critical applications.

In some cases, TI components may be promoted specifically to facilitate safety-related applications. With such components, TI's goal is to help enable customers to design and create their own end-product solutions that meet applicable functional safety standards and requirements. Nonetheless, such components are subject to these terms.

No TI components are authorized for use in FDA Class III (or similar life-critical medical equipment) unless authorized officers of the parties have executed a special agreement specifically governing such use.

Only those TI components which TI has specifically designated as military grade or "enhanced plastic" are designed and intended for use in military/aerospace applications or environments. Buyer acknowledges and agrees that any military or aerospace use of TI components which have **not** been so designated is solely at the Buyer's risk, and that Buyer is solely responsible for compliance with all legal and regulatory requirements in connection with such use.

TI has specifically designated certain components as meeting ISO/TS16949 requirements, mainly for automotive use. In any case of use of non-designated products, TI will not be responsible for any failure to meet ISO/TS16949.

Products

Audio	www.ti.com/audio
Amplifiers	amplifier.ti.com
Data Converters	dataconverter.ti.com
DLP® Products	www.dlp.com
DSP	dsp.ti.com
Clocks and Timers	www.ti.com/clocks
Interface	interface.ti.com
Logic	logic.ti.com
Power Mgmt	power.ti.com
Microcontrollers	microcontroller.ti.com
RFID	www.ti-rfid.com
OMAP Applications Processors	www.ti.com/omap
Wireless Connectivity	www.ti.com/wirelessconnectivity

Applications

Automotive and Transportation	www.ti.com/automotive
Communications and Telecom	www.ti.com/communications
Computers and Peripherals	www.ti.com/computers
Consumer Electronics	www.ti.com/consumer-apps
Energy and Lighting	www.ti.com/energy
Industrial	www.ti.com/industrial
Medical	www.ti.com/medical
Security	www.ti.com/security
Space, Avionics and Defense	www.ti.com/space-avionics-defense
Video and Imaging	www.ti.com/video

TI E2E Community

e2e.ti.com